


AD CAPITAN FUENTES MARTINEZ PORVENIR - CHILE

SCFM IAC 1
VOR RWY 09


ACC PUNTA ARENAS Punta Arenas Center		128.1/123.9	PORVENIR INFORMACION Porvenir Information		126.7
---	--	-------------	--	--	-------

VOR NAS 114.1	FINAL APCH CRS 115°	MNM ALT D17 1300'	MDA(H) 760' (656')	AD Elev. 104'	
-------------------------	-------------------------------	-----------------------------	------------------------------	----------------------	---

APCH FRUSTRADA: En D21.5 VOR NAS viraje izquierda directo VOR NAS, luego según autorización ATC.

Missed Apch: At D21.5 NAS VOR left turn direct to NAS VOR, then according to ATC clearance.


MSA 25 NM NAS

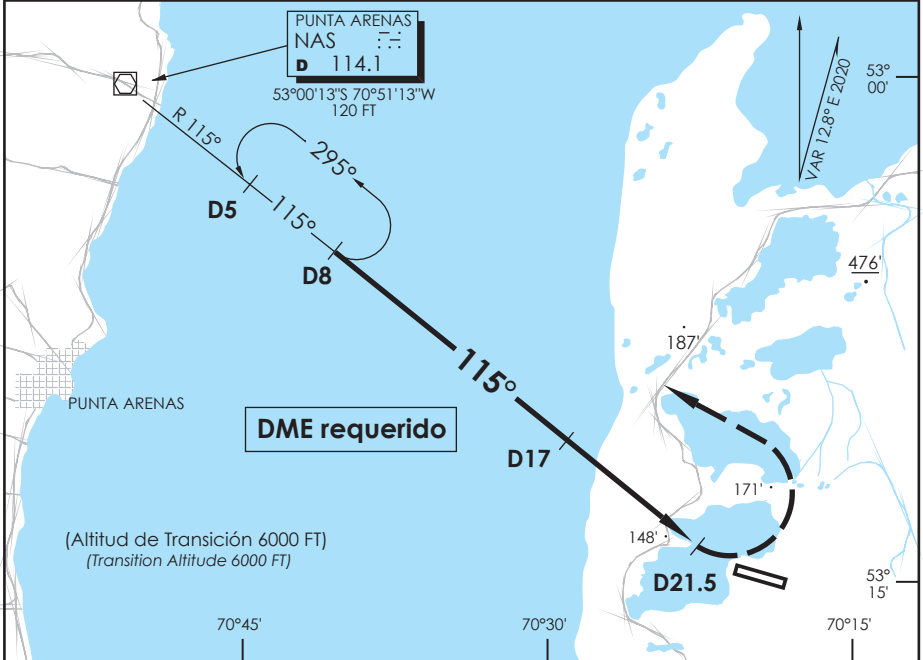

ALT MNM 3000'

Nivel de Transición by ATC SCCI
Transition Level by SCCI ATC

		NAS 114.1
--	--	---------------------

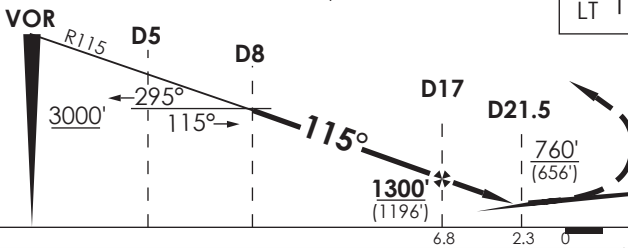

CATEGORIA	DIRECTO RWY 09 <i>Straight in RWY 09</i>		CIRCULANDO <i>Circling</i>	ALTN <i>Alternate Minimums</i>
	MDA 760' (656')			
	A	2.8 Km	800' (696')	VER PAG. GEN 2.19 SEE PAGE GEN 2.19
	B		2.8 Km	
C	4.8 Km			
D	3.2 Km	1080' (976')		

Veloc. Terrestre Kts	80	100	120	140	160

CAMBIO: TA / VAR
Change: TA / VAR

DGAC AMDT 85

13 AGOSTO 2020

DASA / SECCION AS-MAP